

Service Support Spirit

How to connect POWERMAX45 XP Plasma with Scout2

➔ The Plasma connect to Scout-2, 2 cable need to be connected.


➔ Scout 2 connect terminal:

	Terminal No.	
Scout-2 connect terminal	START	The CNC plasma arc initiation signal
	START	
	ARC+	The CNC arc voltage signal
	ARC-	




➔ POWERMAX45 XP Plasma connect terminal:

Note: The customer needs to connect the power cable according to the actual plasma models

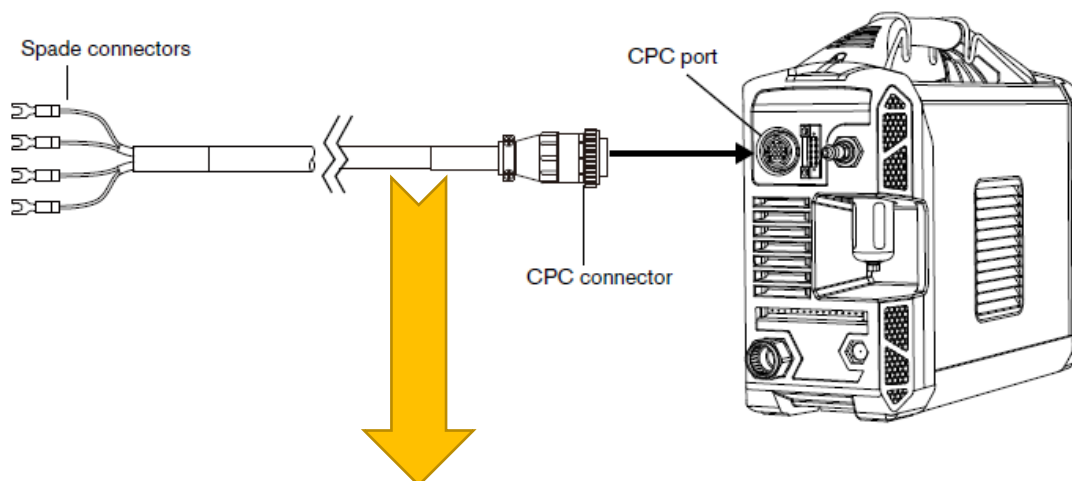

Machine interface pinout

The following figure shows the connector sockets for each type of signal available through the machine interface cable.

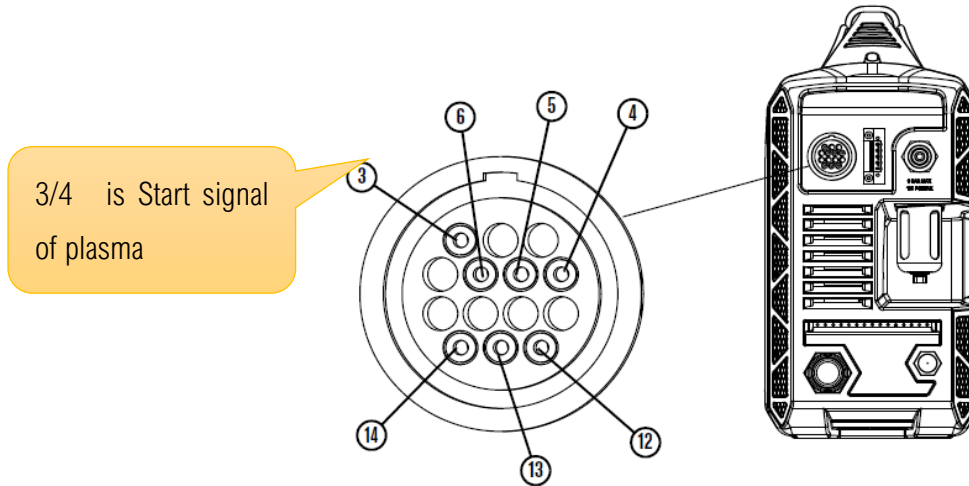


Machine interface cable signals

Refer to the following table for the cable signal details when connecting the power supply to a torch height controller or CNC controller with a machine interface cable.

Signal	Type	Notes	Connector sockets	External cable wires	Internal cable wires
Start (start plasma)	Input	Normally open. 15 VDC open circuit voltage at START terminals. Requires dry contact closure to activate.	3	Green	Black
			4	Black	Red
Transfer (start machine motion)	Output	Normally open. Dry contact closure when the arc transfers. 120 VAC / 1 A maximum at the machine interface relay.	12	Red	White
			14	Black	Green
Voltage divider	Output	Divided arc signal of 20:1, 21.1:1, 30:1, 40:1, 50:1 (provides a maximum of 16 V).	5 (-)	Black (-)	Black (-)
			6 (+)	White (+)	Red (+)
Ground	Ground		13		Green/yellow

Service Support Spirit

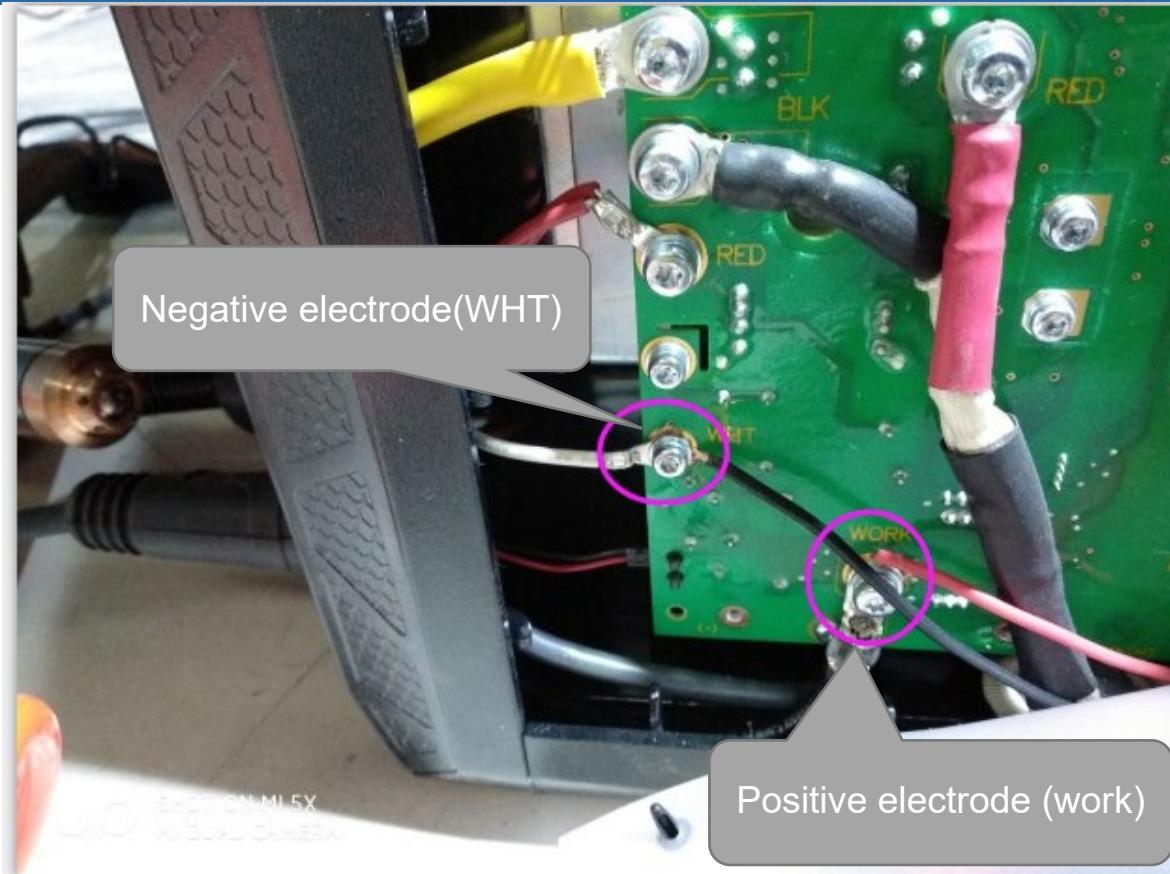

NOTES 1: Positive electrode (work) of Plasma power is connected the ground wire. and check it by multimeter. If **【work】** is not connected the ground wire, please find the other port.

Negative electrode(WHT) of Plasma power is connected the plasma torch. and check it by multimeter; If **【WHT】** is not connected the ground wire, please find the other port.

➔ Cable connecting method:

	Terminal No.	Corresponding interface of POWERMAX45 XP	The interface position
Scout-2 connect terminal	START	3 Input Start	POWERMAX45 XP Interface
	START	4 Input Start	
	ARC+	Positive electrode (work)	
	ARC-	Negative electrode(WHT)	

Service Support Spirit

➔ Signal connection of arc starting



➔ Signal connection of ARC+/ARC-

